

**DEPARTMENT OF TRANSPORTATION**

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave.St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/Ala Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-019608**Date Inspected:** 01-Jan-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 1900**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 700**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** See below**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG Components**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance Inspector (QA Inspector) George Goulet was present during the times noted above for observations relative to the work being performed.

Bay 10

This QA Inspector randomly observed the following work in progress in Bay 10:

SAW welding of butt weld joint BK009A1-001-003 located on PCMK OBG BK009-001, deck plate. Welder was identified as 050295. QC was identified as ZPMC CWI ZPMC CWI Fu Guo Gang (QC2). Assisting QC2 at this location and appearing to be monitoring the welding operation and recording data was ZPMC QC Deng Zhi Bing (QCA2), who was not a CWI. Weld variables recorded by QCA2 appeared to comply with WPS-B-T-2221-B-L2c-S-2 as verbally identified by QCA2. See the photo below showing flame heating of weld joint to maintain interpass temperature as the SAW welding operation proceeds at the other end of the weld joint.


Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

---

# WELDING INSPECTION REPORT

( Continued Page 2 of 2 )

---

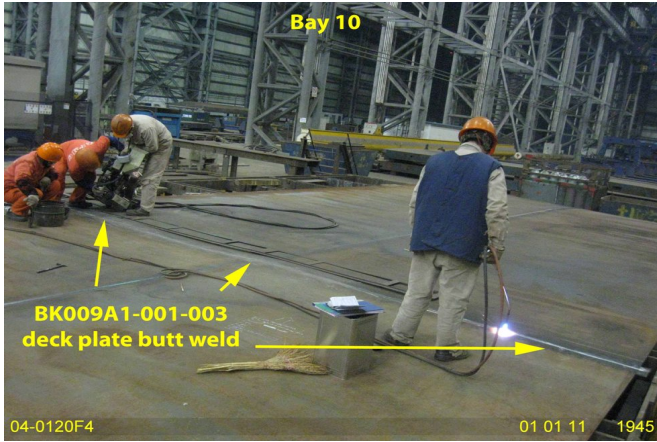

## Summary of Conversations:

As noted above.

## Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Micheal Ng, 159-2184-5703, who represents the Office of Structural Materials for your project.

---

<b>Inspected By:</b>	Goulet, George	Quality Assurance Inspector
<b>Reviewed By:</b>	Riley, Ken	QA Reviewer

---